

150 Dodd Street SE
Marietta, GA. 30060

Phone: 770-973-6251
Fax: 678-401-3854

Email: info@mgs4u.com
Website: www.mgs4u.com





Installation Guide

We will begin by installing the UHF male crimp-on connector on a piece of coax. This process is the same for all the types of coaxial cable that fit this UHF crimp-on connector. These connectors fit on a wide range of coax types, including: LMR-240, LMR-240 Ultraflex, Mini 8, Micro 8/U, RG-59, RG-8X, Belden 8241, Belden 8221, Belden 9169, Belden 9204, Belden 9228, Belden 9258, Belden 1426A, Belden 1505A, Belden 8212, Belden 8241F, Belden 9100, Belden 9110, Belden 9165, Belden 9171, Belden 9240, Belden 9259, Belden 9265, Belden 9274, Belden 9275, Belden 9659, Belden 8279, Belden 8279A, Belden 9209, Belden 9209A, Belden 82241, Belden 88241, Belden 1506A, Belden 1825A, Belden 1826A, Belden 82108, Belden 89108, Belden 89259, and other 0.240 Inch OD Coax.

Identify all connector parts (2 Parts):

Each connector consists of one body assembly (plug) and one rear ferrule (crimp sleeve),


Step 1

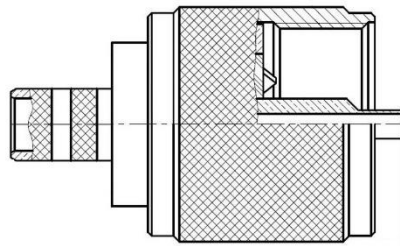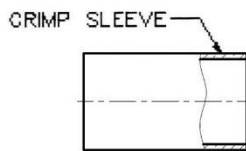

Coax Stripping:

First cut your coaxial cable to the desired length and then strip the black jacket back approximately 33.81mm (1.33"). When the jacket is stripped cut the braid/foil back 25.61mm (1.00") from the fresh cut end. Finally, cut back the dielectric 18.57mm (0.73") from the fresh end down to the center conductor. The braid needs to be cut back further than the dielectric to insure that none of the braid or foil is touching the center conductor which could cause a short.

Once the cable is prepped, **make sure to put the ferrule (crimp sleeve) of the connector on the coaxial cable BEFORE you proceed.**

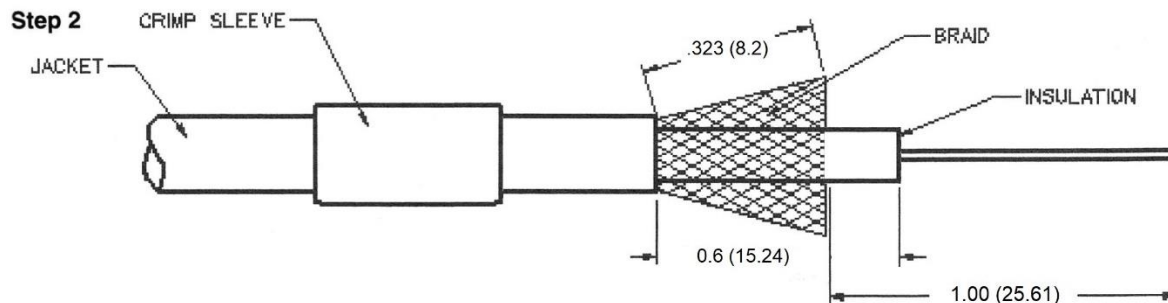

Crimping and Soldering Install:


Soldering Guide (preferred):

This soldering guide is for soldering Max-Gain Systems, Inc. UHF crimp-on connectors. These are approximate measurements for our UHF crimp-on connectors, which adhere to industry standards for this type connector. If you choose to use this guide for connectors sold by others who do NOT adhere to these standards, the measurements could be off and result in a poor installation.

Now we begin by placing the body of the connector onto the end of the coax. Be sure the center conductor goes through the center pin of the connector AND that the braid goes over the knurled section of the connector body. The braid needs to be on the outside of the connector and not tucked under it. This could lead to a short. Trim the excess center conductor with a small pair of diagonal cutters flush with the end of the center pin. Apply heat to the center pin of the UHF connector by placing your soldering iron underneath the pin. Before proceeding, allow sufficient time for the soldering iron tip to reach full operating temperature and clean the tip of the iron by wiping it with a damp sponge. Now apply the solder to the hole tip. The heat rises and heats up the pin faster than positioning the iron above the pin. When the pin is heated the solder will start to flow into the pin. It only takes a little solder to make a good connection. You can apply the solder so that it forms a small bubble / dome on the end of the center pin, but not more than that.

Crimping Guide:


The center pin is crimpable by using the 0.068" hex die from your 7505-DIE-8X ratcheting crimper die to crimp the smaller tapered portion of the center pin. This crimp die is available by itself or as a kit with a ratcheting crimp handle.

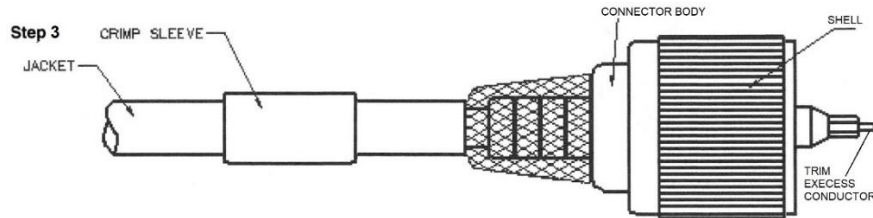

DIE Only	Die and Tool Kit
P/N: 7505-DIE-8X	P/N: 7505-HANDLE-8X
	

Crimping The Ferrule:

Slide the ferrule (placed on the coax at the beginning of Step 2) over the braid and completely up against the connector body. Using the 0.255" hex die from the 7505-DIE-8X installed into the 7505-HANDLE ratcheting crimp handle, crimp the ferrule at the location shown in the picture below (on the ferrule, but right up against the main body of the connector).

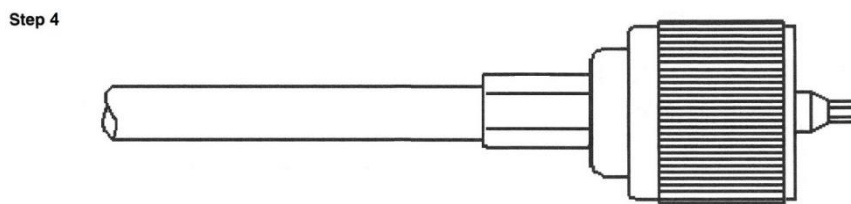

Final Testing:

When this is completed, as a final test, you should always check resistance from the center pin to the body with an ohmmeter in a low resistance scale. After verifying that there are no braid – to – center pin shorts on the other end of the coaxial cable, you should see infinite resistance (open). This completes your UHF male crimp-on connector installation, and the connector is ready for use! Click the following link to obtain additional part information including price, inventory and certifications:

<https://mgs4u.com/product/uhf-male-crimp-connector-for-0-240-inch-od-coax-7505-uhf-8x/>